

UT120C Operating Manual



Pocket Size Type Digital Multimeter

I. Introduction

UT120C is 4000 count notebook type auto-ranging digital multimeter with following advantages: complete functions, stable performance, high accuracy, low power consumption, novel structure, high degree of safety and reliability. It is capable of measuring AC/DC voltage and current, frequency, duty cycle, resistance, capacitance, diode forward voltage drop and continuity, and becomes an ideal choice for measurement.

This manual specifies safety information and notes related to this meter, please read the manual carefully before use and strictly follow all warnings and notes during the operation.

⚠ Warnings:

Please read "rules for safe operation" before operating the meter.

II. Safety Information

Pay attention to ⚠ warning symbol and its corresponding contents. A Warning states situations or actions that may cause potential risks to users or damage to the meter or measured equipments.

UT120C is designed and manufactured in accordance with safety standards IEC61010, Double Insulation and CAT II 600V as well as Pollution Degree 2.

⚠ Warnings:

Operate the meter as specified in the manual; otherwise the protection offered the meter will be impaired.

1. Please ensure test leads are good and no insulation damage or broken wires before use. If test lead or meter housing is found with any obvious damage or undetermined failure, do not use the meter.
2. Keep your hands behind the finger guards during the operation.
3. To avoid electric shock or damage to the meter do not apply voltage above 600V between meter terminals and grounding
4. Please use caution when working voltages above DC60V and AC 42 Vrms so as to prevent electric shock.
5. The meter is prohibited to use when back cover is not well placed, otherwise, it may cause electric hazard.
6. Do not exceed the specified limit value in order to avoid shock hazard or meter damage
7. Function switchover is not allowed during measurement so as to

protect the meter.

8. Do not change internal wiring without authorized permission which may endanger the meter or users.
9. To ensure accurate readings, please change batteries timely if ⚡ icon appears.
10. Do not use the meter in environments exposed to high temperature and humidity, especially for stored meter which may not run normally after moisture-affected.
11. Clean the meter housing with soft cloth dampened with mild detergent, any abrasive or corrosive is prohibited.

● International Electrical Symbols

⚡ Low Battery Display	⬇ Earth Ground	⚠ Warning
~ AC(Alternating Current)	⎓ DC (Direct Current)	⊞ Double Insulation
🔊 Buzzer Continuity	➔ Diode	⊕ Capacitance
Ⓢ Conformity with Europe Demand		

III. Meter Description (See Figure 1)

1. LCD Display
2. DC&AC Voltage and Current, Resistance, Capacitance, Diode, Continuity measurement selector (SELECT Button)
3. Relative Measurement (REL Button)
4. Function Selection Switch
5. Hz/% Measurement (V, uA, mA and Hz% Functions)
6. Data Hold (Hold Button)
7. Positive Input End (Red Test Lead)
8. Negative Input End (Black Test Lead)

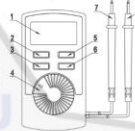


Figure 1

IV. Button Functional Description

1. SELECT Button

Used for switchover between DC & AC voltages, DC&AC Currents as well as among resistance, capacitance, buzzer continuity and diode measurements, indicated by beeping during the operation. Pressing this button can wake up the meter from sleep mode, which however will cancel the auto sleep function.

2. REL Button (Relative Measurement)

With this button pressed down, current reading is set as reference value which will be subtracted from subsequent readings. Press again to exit this mode and return to normal measuring status. This function is not available under frequency and duty cycle measurements.

3. HOLD Button (data hold)

Press this button to lock displayed values, release it to unlock this status and return to normal measuring mode.

4. Hz/% Measurement

The meter can switch into Hz or % measurement with this button pressed down if currently under V/uA/mA function (also used for frequency and duty cycle selection); when Hz/% operation is finished, the meter will return to V/uA/mA status with fixed range 400mA for DCV or 4V for ACV and meanwhile "AUTO" icon on LCD disappears. If high voltage is under test at the moment, set rotary switch to desired range or turn the meter off to reset auto-ranging for V/uA/mA function before starting the measurement.

Under Hz/% mode, press down Hz/% button to switch between frequency and duty cycle measurements

V. Operating Instructions

Switch on the meter to check if there is ⚡ icon on the LCD, if any, it indicates the power supply falls low. To ensure high accuracy for measurement, please change batteries. You should also take notice of ⚠ warnings, which indicates not to exceed maximum input limit when measuring voltage.

1. Measuring DC Voltage(See Figure 2)

- (1) Set rotary switch to V position, AUTO and DC icons appear on LCD;
- (2) Connect test leads to the power under test (Black to cathode, red to anode);

- (3) Read measuring results displayed on LCD;
- (4) Reverse test leads, then LCD will display negative readings.

2. Measuring AC Voltage (See Figure 2)

- (1) Set rotary switch to V position and press SELECT button, then LCD will display AUTO, AC icons;
- (2) Connect test leads to the power under test (Black to cathode, red to anode);

- (3) Read measuring values indicated on LCD;
- (4) If reversing test lead connection, LCD will indicate negative readings.

⚠ Warnings:

- Do not input voltage above 600V, you may get desired values, however, which causes hazard to internal wiring.
- To avoid electric shock use extreme caution when measuring high voltage.
- Disconnect test leads with measured circuits after finishing all the operations

3. Measuring Resistance(See Figure 3)

- (1) Set rotary switch to Ω-4 ⊕ ⊖ position;
- (2) Connect test leads to the resistor under test;
- (3) Read measured results on the LCD.

⚠ Warnings:

- Please ensure to turn off the power and discharge all capacitors before measuring online resistor so as to avoid meter damage.
- As for resistance 400 Ω range measurement test leads will cause error 0.1 Ω ~ 0.3 Ω to readings. In order to get accurate readings, the final results should subtract the value when two test leads short circuit. It is suggested performing the operation under relative measurement mode.
- The meter should display "OL" if no signal is input, for instance, open circuit.
- For measurement > 1M Ω, it normally takes several seconds to get stable readings

4. Measuring Frequency and Duty Cycle (See Figure 4)

- (1) Set rotary switch to Hz/% or V/uA/mA position;
- (2) Press Hz/% button to access frequency measurement;
- (3) Connect test leads to frequency signal source under test;
- (4) Read results on LCD;



Figure 2



Figure 3

 


Figure 4

(5) Press Hz/% button again to access % measurement.

Warnings:

- The measuring resolution will vary slightly based on frequency and waveform that have been input, and resolution for this meter is set with reference to sine wave.

5. Testing Diodes and Continuity(See Figure 5)

- Set rotary switch to $\Omega \rightarrow \rightarrow \rightarrow$ position.
- Press SELECT button to access diode measurement mode (repress to go into continuity testing).
- Connect test leads to measured diode (red to anode, black to cathode), then LCD reading is approximate value for diode forward voltage drop (if resistance between two terminals of circuits under test is $\leq 60 \Omega$, the meter will beep and display resistance value on LCD).

Warnings:

- If measured diode is under open circuit status or reversing the polarity (namely, black to anode, red to cathode), the meter displays "OL" on LCD.
- This function can also measure PN voltage drop of diode or semiconductor. The reading of forward voltage drop should be within 0.5~0.8V for a normal silicon semiconductor.
- Turn the circuit power off and discharge the capacitor before measuring online diode so as to avoid meter damage.
- Do not input voltages above DC60V or AC 30Vrms to prevent damage to the meter or personal injury.



Figure 5

6. Measuring Capacitance(See Figure 6)

- Set rotary switch to $\Omega \rightarrow \rightarrow \rightarrow$ position.
- Press SELECT button three times to access capacitance status.
- Given there is still readings under open circuit, choose relative measurement mode.
- Press REL button one time.
- Connect test leads to capacitance under test, then read data on LCD.



Figure 6

Warnings:

- Completely discharge all capacitors before measurement.
- As for online capacitor measurement, it must cut off all power supply of measured circuits and discharge completely all capacitors.
- When measuring capacitance with polarity distinction, ensure right connection between test leads and capacitor (red to anode, black to cathode).
- It normally takes several seconds to display readings when measuring more than 10 μ F capacitance.
- To avoid damage to the meter or personal injury do not apply voltages above DC60V or AC 30Vrms.

7. Measuring DC & AC Current(See Figure 7,8)

- Set rotary switch to " μ A" or "mA" position, and press SELECT button to choose desired DC or AC range, then Connect test leads in series to measured loop.
- Read current readings on LCD
- It is RMS value displayed by UT120C when measuring AC current (Sine wave)



Figure 7



Figure 8

Warnings:

- Cut off the current before connecting the meter to the loop, otherwise spark hazard occurs
- Please ensure right input terminals and functions are selected during measurement, start from higher range if not sure about current flow under test.
- UT120C is not expected to measure current higher than 400mA.
- Do not connect test leads in parallel to any circuit, otherwise it may burn internal fuse and damage the meter.
- Cut off the power supply and then disconnect test leads with circuits under test after finishing all operations, which is particularly important when measuring large current

VI. Technical Specifications

General Specifications

- Max. Input Voltage between Voltage Terminal and Grounding: 600VRMS or 600DCV
- Range Selection: Auto-ranging
- Measuring Speed Rate: 3 times per second
- Max. Display: 3999, 3 1/2 digits
- Over-Load Display: "OL"
- Polar Indication: "-" icon for negative input
- Low Battery Display: on LCD
- Battery: one Lithium-manganese button cell, 3V, model: CR2032
- Operating Temperature: 0 $^{\circ}$ C ~ 40 $^{\circ}$ C (32 $^{\circ}$ F ~ 104 $^{\circ}$ F)
- Humidity: \leq 75%
- Storage Temperature: -10 $^{\circ}$ C ~ 50 $^{\circ}$ C (14 $^{\circ}$ F ~ 122 $^{\circ}$ F)
- Operating Altitude Height: \leq 2000m
- Dimensions: 109.8mm \times 58.2mm \times 10.8mm
- Weight: about 76 g(test leads & batteries included)
- Auto Power Off
The meter goes into sleep mode after 30 minutes of inactivity or rotary switch and buttons. It can restore the operation (working mode) using rotary switch or any button on the front panel. This function will be canceled if pressing SELECT button to power on

Accuracy Specifications

Accuracy: \pm (a% readings+ b digits), warranty period: one year;
Ambient Temperature: 23 $^{\circ}$ C \pm 5 $^{\circ}$ C;
Relative Humidity: \leq 75%;

Functions	Range	Resolution	Accuracy \pm (a% readings+ b digits)	Input Protection	Description
DC Voltage	400mV	0.1mV	\pm (0.8%+3)	600V DC 600 V AC	Input Impedance \geq 10M Ω
	4V	1mV			
	40V	10mV	\pm (0.8%+1)		
	400V	100mV			
DCV	600V	1V	\pm (1%+3)		

AC Voltage	4V	1mV	\pm (1.2%+3)	600V DC 600 V AC	Input Impedance \geq 10M Ω Frequency Response: 40Hz~400Hz; Display: RMS of Sine wave (Mean Value Response)	
	40V	10mV				
	400V	100mV				
	600V	1V				
ACV	400 Ω	0.1 Ω	\pm (1.2%+2)	600 V AC	0.45V for open circuit status	
	4K Ω	1 Ω				
	40K Ω	10 Ω				
	400K Ω	100 Ω				
Resistance	4M Ω	1K Ω	\pm (1.2%+2)	600 V AC	0.45V for open circuit status	
	40M Ω	10K Ω				
	4.000nF	0.001nF				For reference
	40.00nF	0.01nF				
400.0nF	0.1nF					
4.000 μ F	0.001 μ F	Measured under relative measurement 0.45V for open circuit				
40.00 μ F	0.01 μ F					
400.0 μ F	0.01 μ F		Just for reading reference when measured capacitance above 100 μ F			
4.000mF	0.01mF					
100 μ F	0.1 μ F	\pm (5%+10)				
Capacitance	99.9Hz	0.1Hz		\pm (0.5%+3)	600 V AC	Input sine wave 10Hz~10kHz: \geq 1Vrms 10kHz~100kHz: \geq 30Vrms
	0.999kHz	0.001kHz				
	9.999kHz	0.01kHz				
	99.99kHz	0.1kHz				
Frequency	99.9Hz	0.1Hz	\pm (0.5%+3)	600 V AC	Press DUTY button to switch into DUTY measuring mode f under AC/DC mode (just for reading reference)	
	99.99kHz	0.1kHz				
Duty Cycle	\pm 1%~99.9%	0.10%		600V AC		
	Diode		1mV	0.5V \sim 0.8V	600V AC	1.5 V for open circuit status
Buzzer Continuity		0.1 Ω	About \leq 60 Ω	600V AC	Continuity Resistance \leq 60 Ω : buzzer beeps; $>$ 60 Ω : not necessary beep, resistance approximate value displays, unit is Ω	
Low Battery Display			About $<$ 2.4V		icon appears	
DC Current	400 μ A	0.1 μ A	\pm (1.0%+3)	Fuse	400mA, 600V	
	4000 μ A	1 μ A				
	40mA	10 μ A				
	400mA	100 μ A				
DCA	400 μ A	0.1 μ A	\pm (1.2%+5)	Fuse	400mA, 600V	
	4000 μ A	1 μ A				
	40mA	10 μ A				
	400mA	100 μ A				
AC Current	400 μ A	0.1 μ A	\pm (1.5%+5)	Fuse	400mA, 600V	
	4000 μ A	1 μ A				
ACA	40mA	10 μ A	\pm (2%+5)	Fuse	400mA, 600V	
	400mA	100 μ A				

VII. Battery Replacement (See Figure 9)

- If icon appears on LCD, please change batteries and do as below:
- Disconnect test leads with circuits under test, set rotary switch to OFF position, then power off the meter.
 - Unscrew the back housing and remove it.
 - Replace old batteries with the new 3V.



Figure 9

The Operating Manual will change without notice!

UNI-T
UNI-TREND TECHNOLOGY (CHINA) CO., LTD.
No.1, Gong Ye 1st Road,
Songshan Lake National High-Tech Industrial
Development Zone, Dongguan City,
Guangdong Province, China
Tel: (86-769) 8572 3888
http://www.uni-trend.com

DIGINDT.IR
FGJ-NDT.IR

+982165565901
 +982144584619
 +989034119385
 Tehran, Tehransar